



Service Info



Similar tensioner pulley design

Differentiating characteristics

Manufacturer: Audi, Ford, Seat, Skoda, Volkswagen

Models:

- Audi: A2, A3, A4, A6
- Ford: Galaxy
- Seat: Alhambra, Arosa, Leon, Toledo
- Skoda: Fabia, Octavia, Superb
- Volkswagen: Bora, Golf, Lupo, New Beetle, Passat, Polo, Sharan

Engines: 1.2 TDI, 1.4 TDI, 1.9 TDI

Part no.: 531 0396 20 + 533 0039 10
531 0436 20 + 533 0035 10

For current listing refer to catalogue media

For the vehicles listed here, always be sure to observe the specified tensioner pulley and vibration damper combination.

Tensioner pulleys and vibration dampers are perfectly matched to one another and only the right combination guarantees the smoothest possible engine timing.

A mixed configuration can lead to increased wear or even failure of individual timing system components.

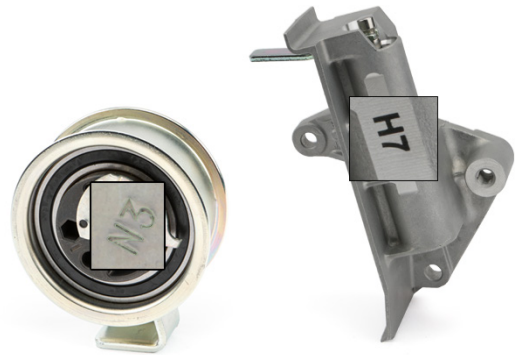


Photo 1: Tensioner pulley 531 0396 20 with vibration damper 533 0039 10



Photo 2: Tensioner pulley 531 0436 20 with vibration damper 533 0035 10

Part No. Tensioner	Eccentric ID	Color Eccentric	Part No. Damper	Damper ID
531 0396 20	N3	silver	533 0039 10	H7
531 0436 20	N2	black	533 0035 10	H4

Please observe the vehicle manufacturer specifications!

You want more? We can help!

Phone: +44 (0) 1432 264 264
 Fax: +44 (0) 1432 375 760
 aftermarket.uk@schaeffler.com
 www.repxpert.co.uk

Issued 03.2018 INA 0179 Technical content subject to change
 O.E. Manufacturer's names and numbers are used for reference purposes only
 © 2018 Schaeffler Automotive Aftermarket GmbH & Co. KG

